



Technical Bulletin


C-Weigh Fork Indicator Positive Battery Terminal Modification

Cascade has identified an issue with battery powered C-Weigh Fork Indicators that are losing power due to a weak connection between the indicator positive contact plate and battery positive terminal. This bulletin covers indicators shipped prior to September 2018. Follow the steps below to solve the problem.


For the contact plate modification, Cascade is authorizing .5 hour for each indicator.

- 1 Remove the indicator from the mounting bracket.
- 2 Remove the rear battery cover from the indicator.
- 3 Remove the batteries from the indicator.
- 4 Insert a small screwdriver blade between the positive contact plate and slot in the indicator body. Turn the screwdriver blade to make a small bend the contact plate.

- 4 Make a small bend in the contact plate

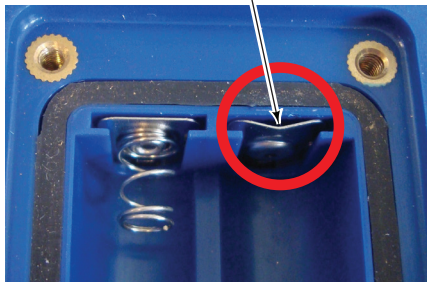

FK0761.eps

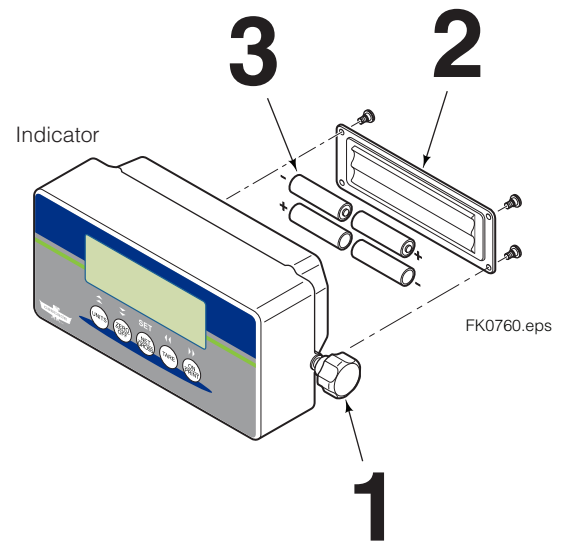

- 5 Reassemble the indicator. Press the indicator power ON button to confirm battery power is restored.
- 6 Reattach the indicator to the mounting bracket.

If you have any questions regarding modifications to the indicator, contact Cascade Technical Support using the contact information below.

cascade[®]
corporation

For Technical Support . . .

Call: 1-800-227-2233 Fax: 1-888-329-8207
Warranty email: Tech-Support-Team@cascorp.com
Internet: www.cascorp.com

© Cascade Corporation 2019

NOTE: This information should not be interpreted as the basis for warranty claims unless so designated.

To Order Parts . . .

Call: 1-888-227-2233 Fax: 1-888-329-0234
Internet: www.cascorp.com

08-2019

Part No. 6932039