



Number 146

June 1984

Technical Bulletin


45C Viewmast® II Channel Spacer Kit 675277 Installation Instruction

MODEL: 45C Viewmast® II Quad Lift Masts

PROBLEM: When the mast is fully extended the outer channel load rollers are wearing excessively on the inner surface of the intermediate upright.

SOLUTION: Install Channel Spacer Kit 675277 to the outer upright at the locations shown below. The spacer kit will take up space between the outer intermediate channel and outer channel to eliminate the wear problem. The spacer kit includes the following parts:

- 2 675278 Cover Plates
- 2 675279 Plastic Plates
- 6 675280 Shims
- 4 4870 Capscrews, 5/16 NC X .62

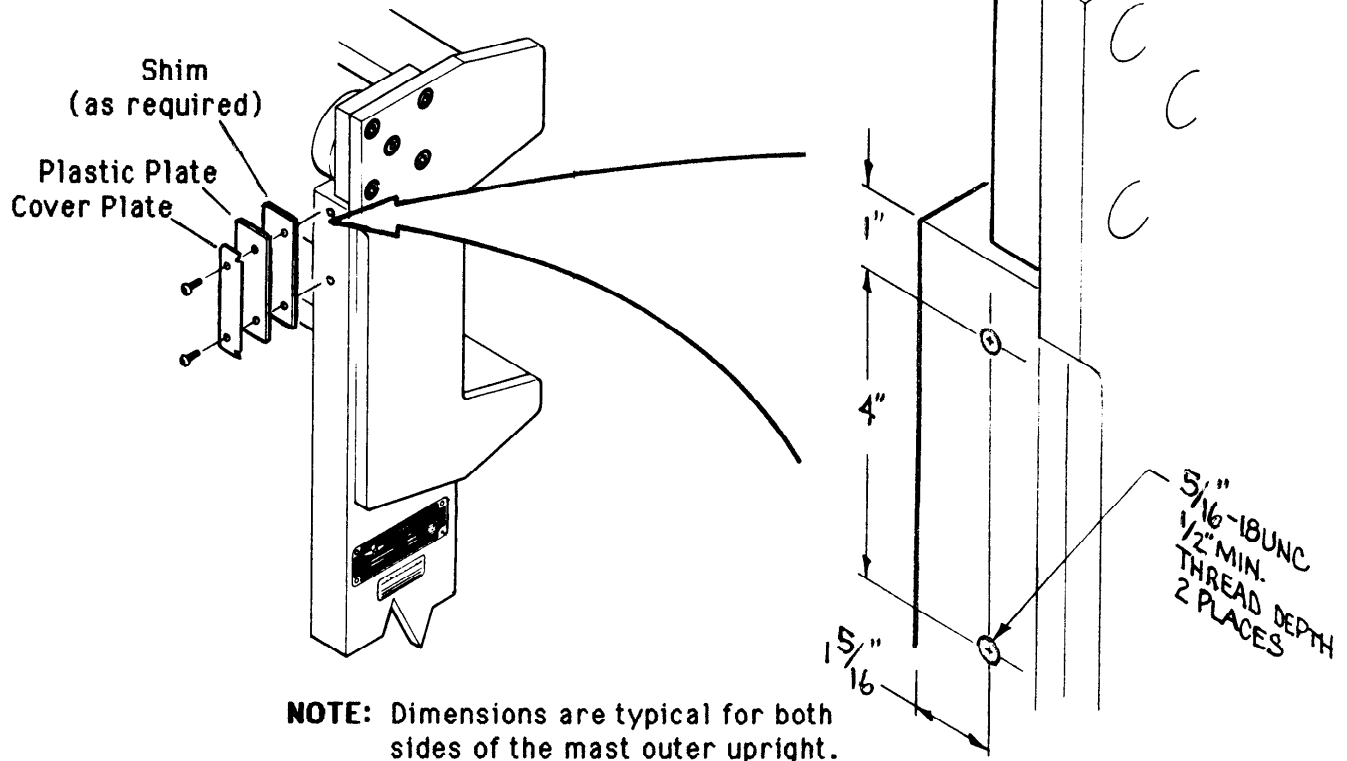

Part Number 675281

cascade® corporation

For Technical Assistance . . .

Call: 1-800-CASCADE or 503-666-1518

OR

Write: Cascade Corporation, P.O. Box 20187, Portland, OR 97220

To Order Parts . . .

Call: 513-322-1199

OR

Write: Cascade Corporation, P.O. Box 360 Springfield, OH 45505